

What It Takes To Repair A Small Ansonia Carriage Alarm Clock

Or

Why Did You Have My Clock So Long?

Ansonia (Astral) Novelty Carriage Alarm



\$6.00 in 1904










M
A

Co


clock
plate

spring
spring

replaced

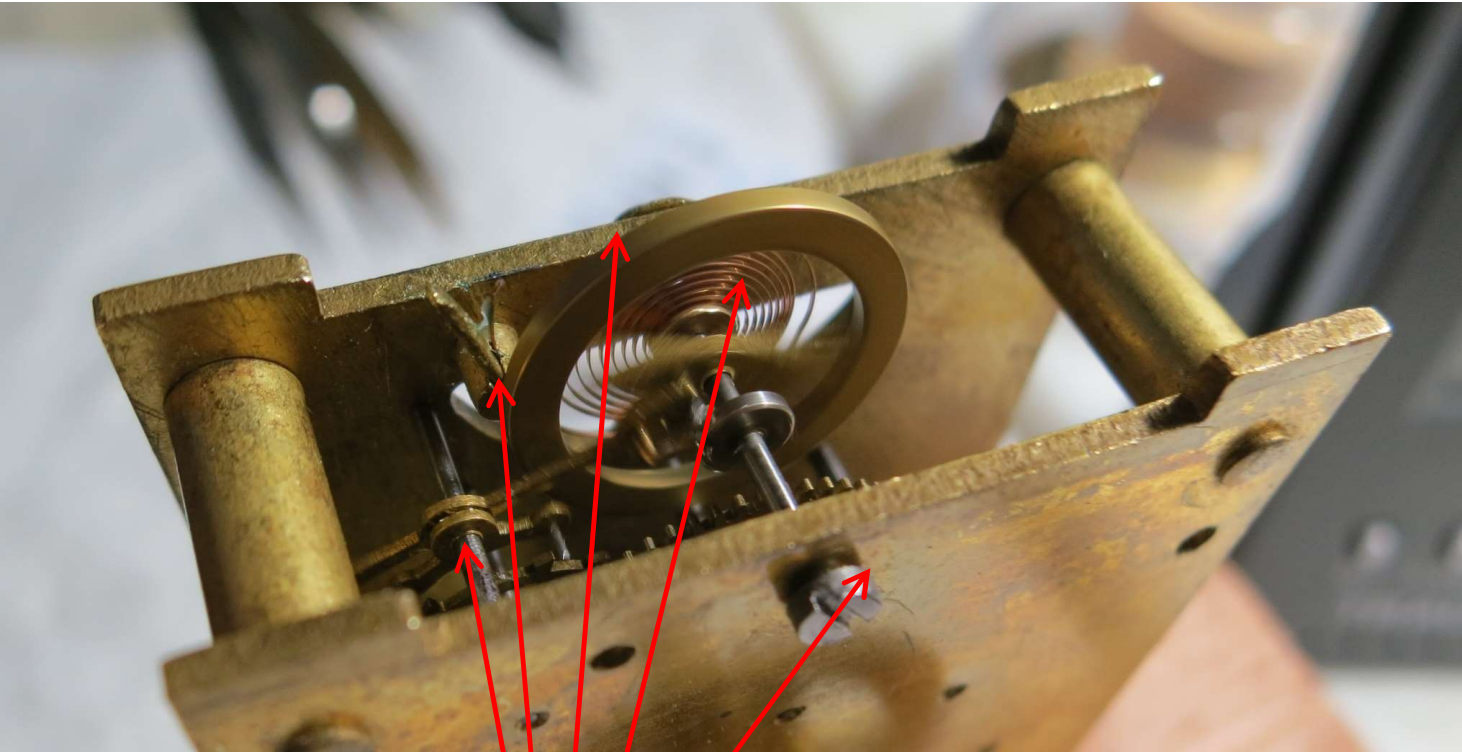


Balance problems

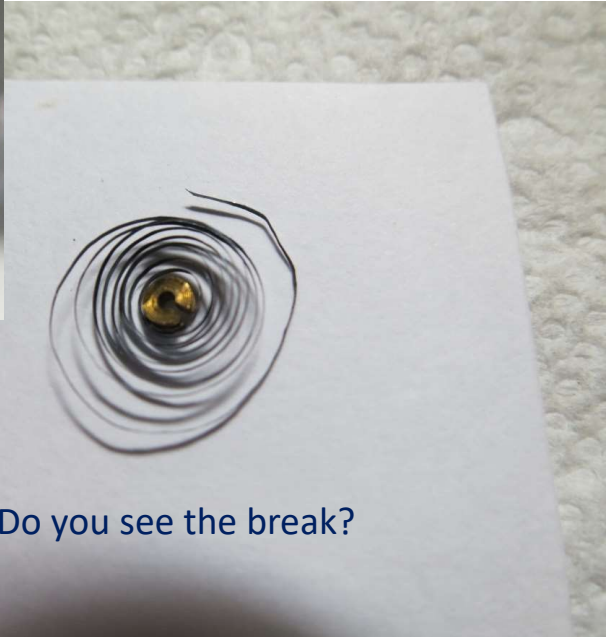

Do you see the break?


Some Problem Areas

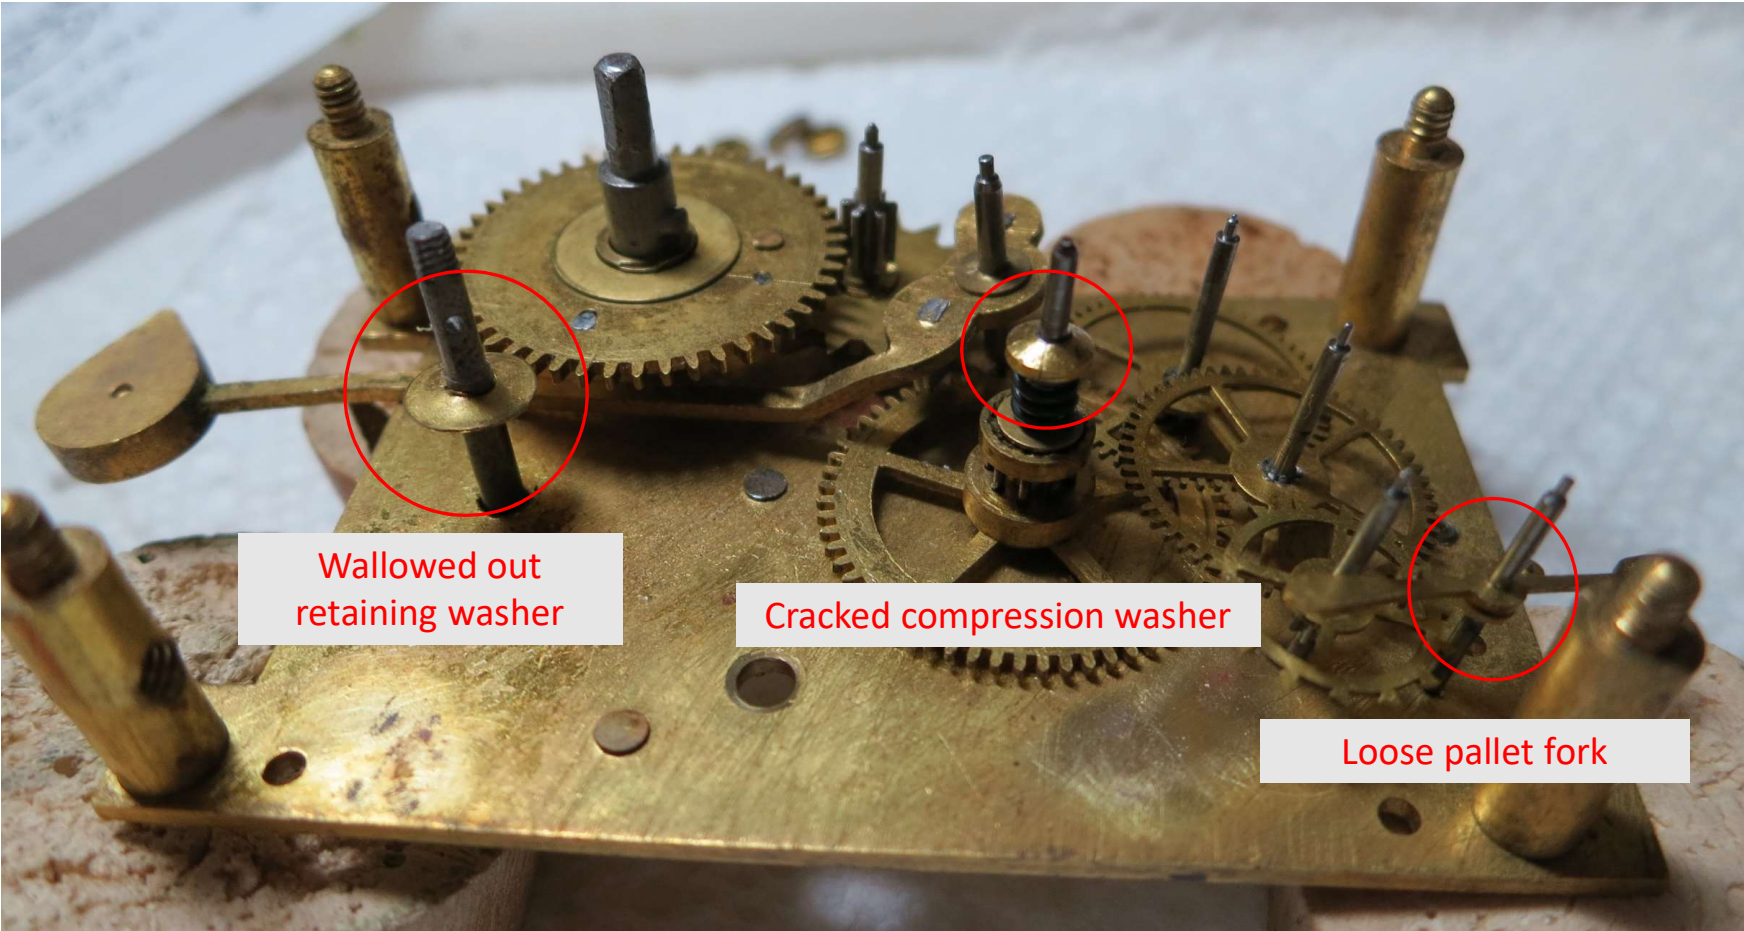

Wallowed out retaining washer



Cracked compression washer


Loose pallet fork

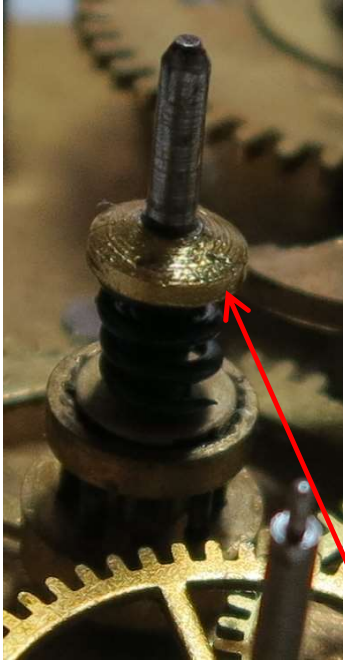

Second wheel compression washer
Result = erratic, slow or no hand movement



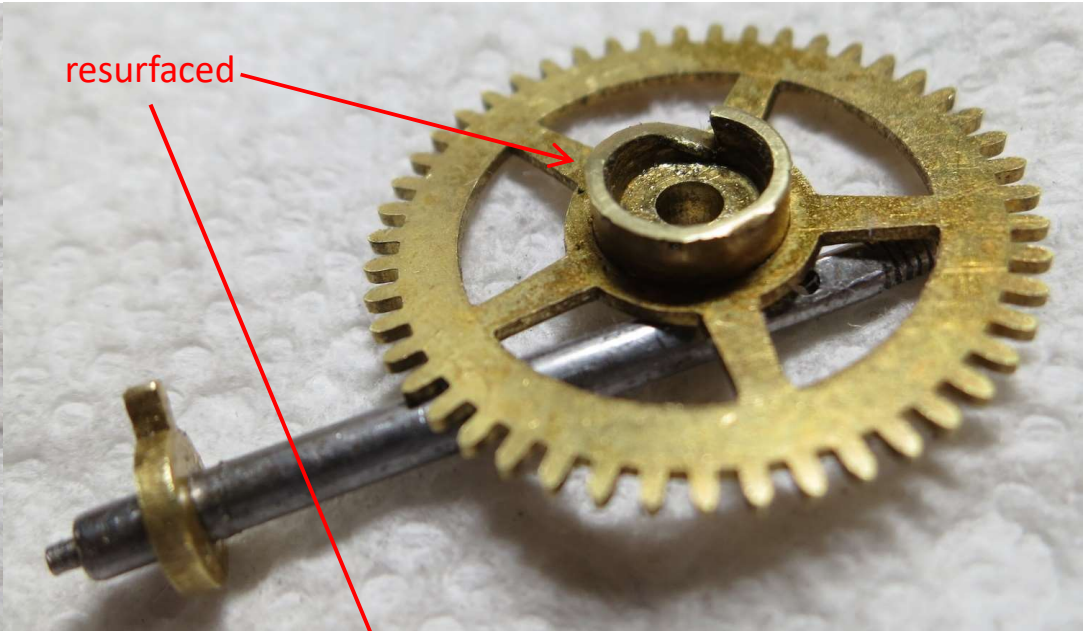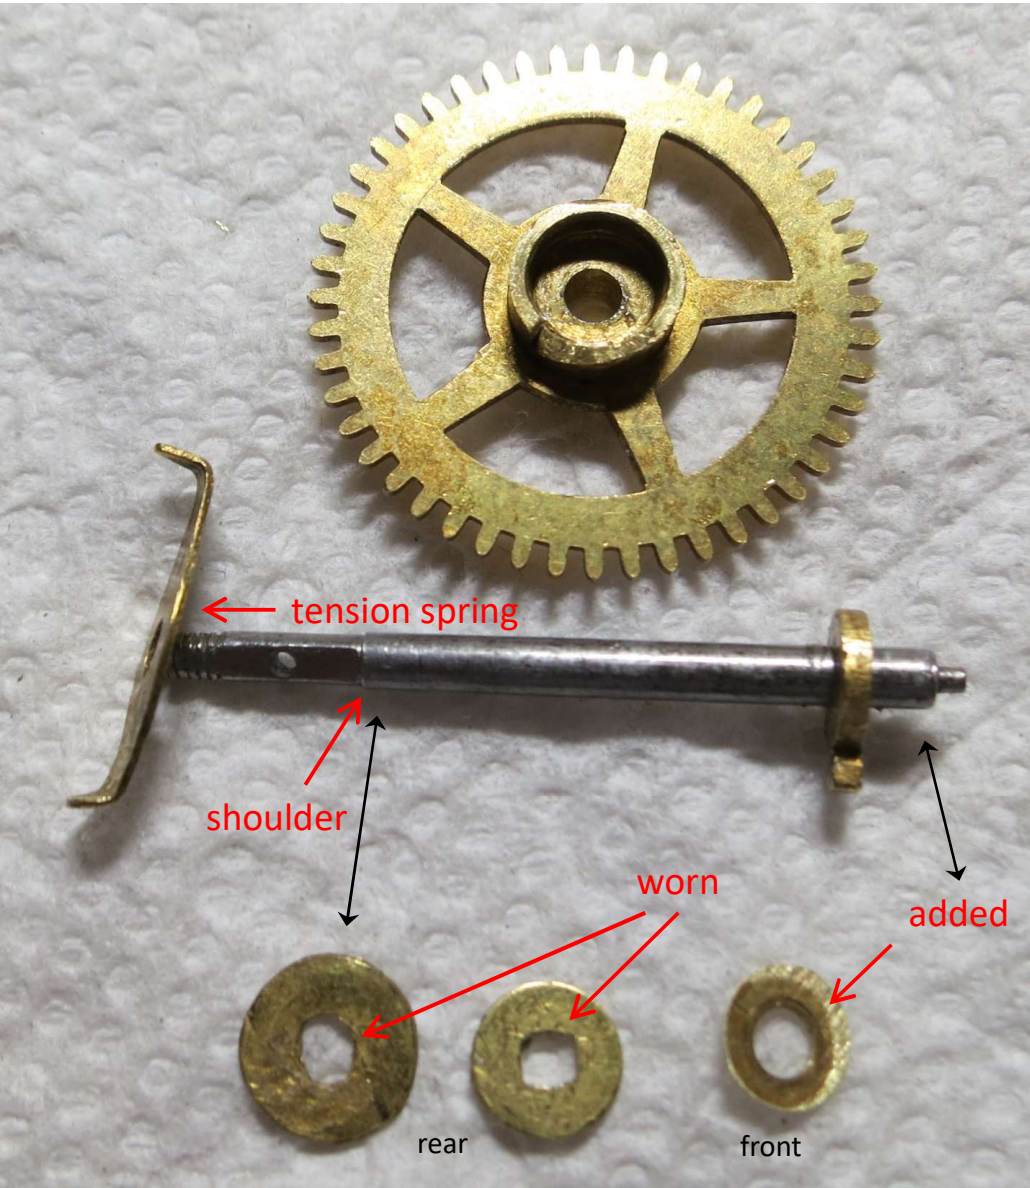

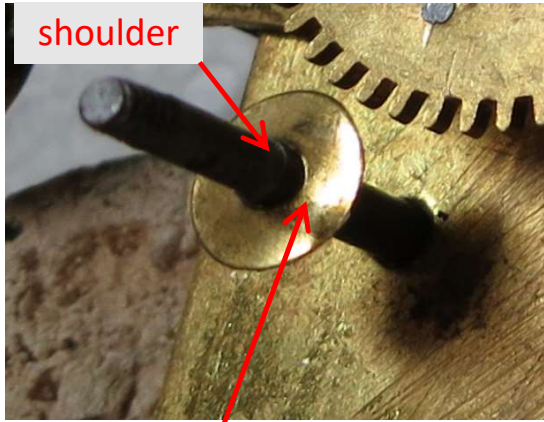


shoulder

Damaged retaining washer on alarm setting arbor

Replaced
(be aware of thickness)



Note thickness

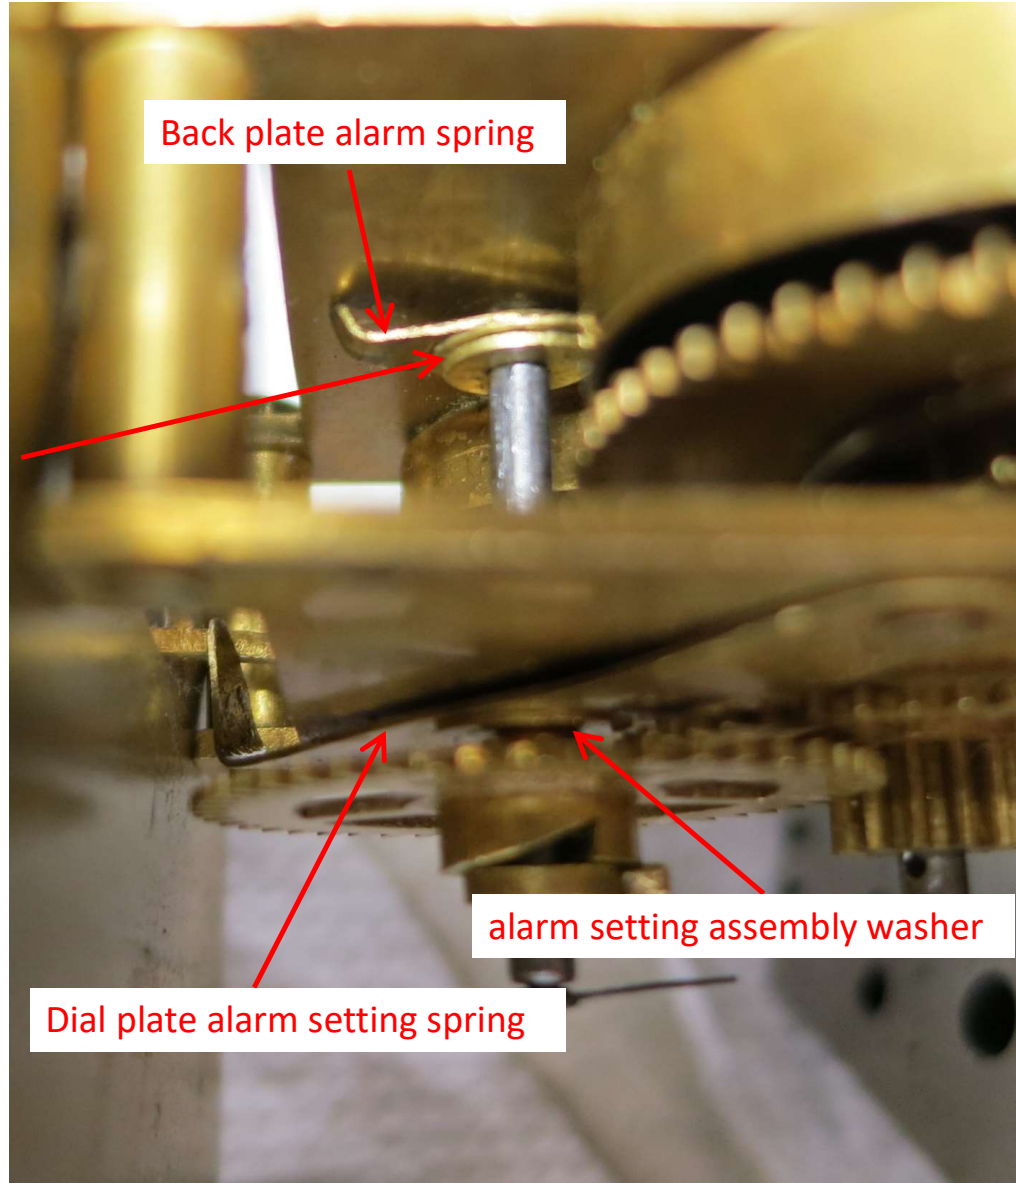



Back plate alarm spring

alarm setting assembly washer

Dial plate alarm setting spring

Back plate spring must provide greater friction on components than that of the dial plate alarm spring or the alarm setting will move with time train

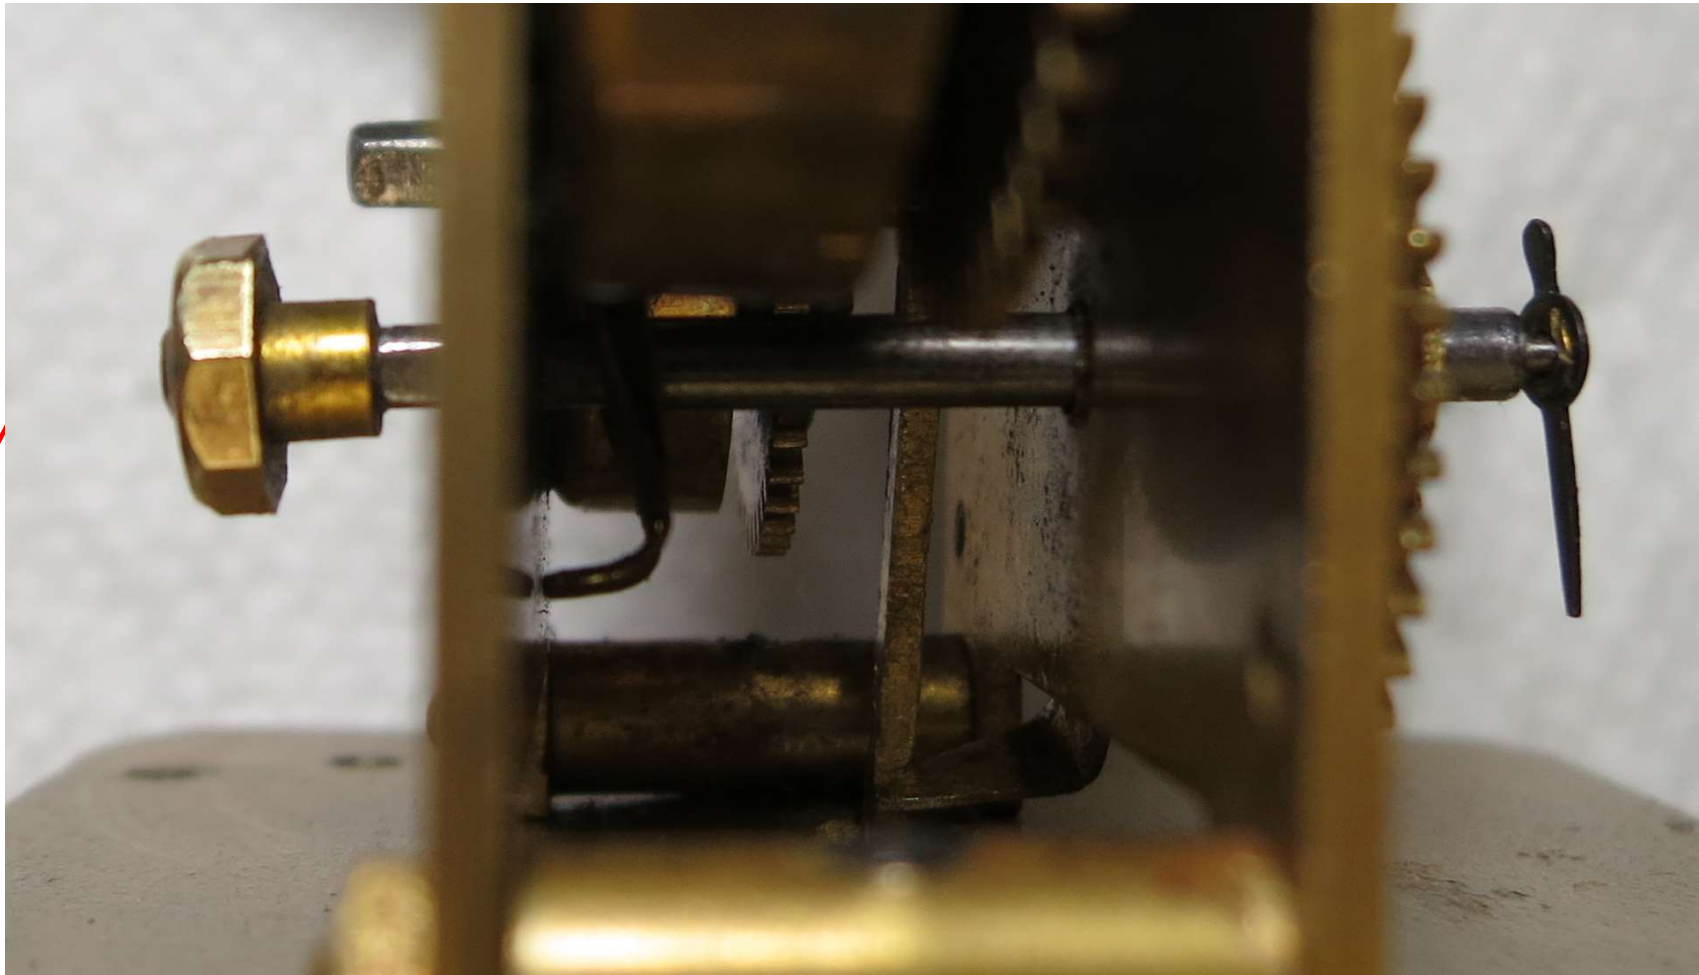

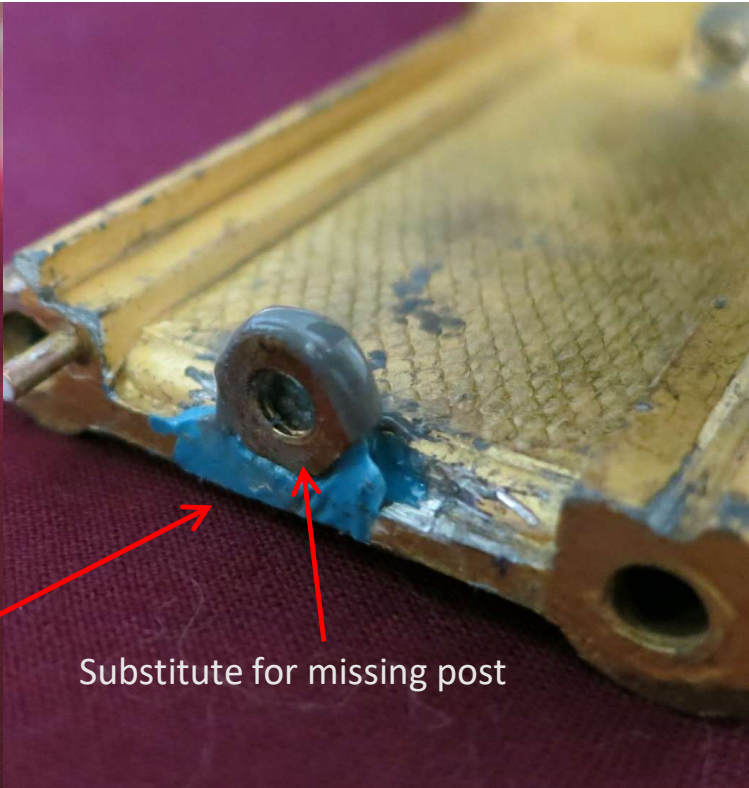

Ansonia (Astral) Novelty Carriage Alarm



